




*Comprehensive Guide to* **DYMAX UV LIGHT  
CURING TECHNOLOGY**

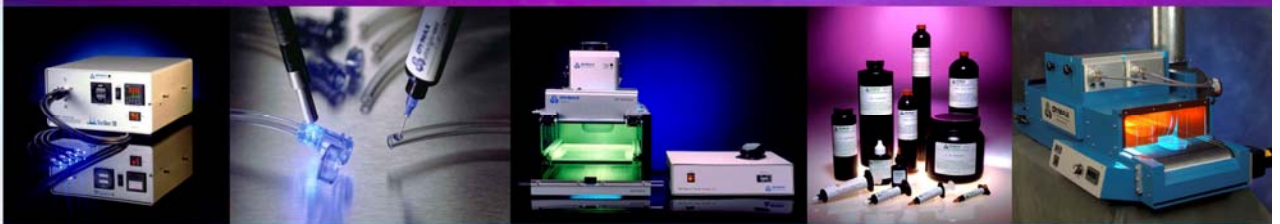

 **DYMAX<sup>®</sup>**

*Making Manufacturers More Efficient*

# TABLE OF CONTENTS

## 1. DYMAX

1.1 About DYMAX .....	Page 4
1.2 What Does DYMAX Sell? .....	Page 5
1.3 Who Uses DYMAX? .....	Page 5
1.4 Advantages of DYMAX Light Curing Materials (LCMs) .....	Page 6
1.5 Specific Advantages of DYMAX LCMs Over Other Chemistries .....	Page 6
1.5.1 Versus One-Part Silicones .....	Page 7
1.5.2 Versus Cyanoacrylates (CAs) .....	Page 7
1.5.3 Versus Two-Part Epoxies .....	Page 8
1.5.4 Versus One-Part Epoxies .....	Page 8
1.5.5 Versus Two-Part Urethanes .....	Page 8
1.5.6 Versus Hot Melts .....	Page 9
1.5.7 Versus Solvent-Based Adhesives .....	Page 9

## 2. LIGHT CURING MATERIALS (LCMs)

2.1 The Chemistry Behind Light Curing Materials (LCMs) .....	Page 10
2.2 Typical Properties of Light Curing Materials (LCMs) .....	Page 10
2.2.1 Cure Speed .....	Page 10
2.2.2 Depth of Cure .....	Page 10
2.2.3 Adhesion .....	Page 10
2.2.4 Viscosity .....	Page 11
2.2.5 Hardness and Flexibility .....	Page 12
2.2.6 Temperature Resistance .....	Page 12
2.2.7 Thermal Cycling .....	Page 12
2.2.8 Chemical and Moisture Resistance .....	Page 12
2.2.9 Clarity, Color, Fluorescing, and Refractive Index .....	Page 13
2.2.10 Shrinkage and Coefficient of Thermal Expansion .....	Page 13
2.2.11 Outgassing .....	Page 13
2.2.12 Odor .....	Page 13
2.2.13 Flammability .....	Page 13
2.3 Chemical Safety .....	Page 13
2.4 Environmental Impact .....	Page 14
2.5 Specifications .....	Page 14
2.6 Shelf Life and Storage .....	Page 14
2.7 Cleaning and Rework .....	Page 14
2.8 Disposal .....	Page 14

# TABLE OF CONTENTS

## 3. DYMAX LIGHT CURING EQUIPMENT AND PROCESS

3.1 UV and Visible Light .....	Page 15
3.2 Basic Concepts of Light Curing .....	Page 15
3.3 DYMAX Light Curing Equipment .....	Page 16
3.3.1 Power Supply Options .....	Page 16
3.3.2 Spot Lamps.....	Page 16
3.3.3 Focused Beam Lamps.....	Page 17
3.3.4 Flood Lamps .....	Page 17
3.3.5 Conveyors.....	Page 17
3.3.6 Radiometers .....	Page 18
3.3.7 Selecting a Curing System .....	Page 18
3.3.8 Equipment Trial Rental/Lease Program.....	Page 19
3.4 UV Lamp Safety .....	Page 19
3.5 Eliminating Tacky Surfaces .....	Page 19
3.6 Shadow Curing.....	Page 20
3.7 Light Curing Through Transparent, UV-Blocked Substrates .....	Page 20
3.8 Confirming Complete Cure.....	Page 20
3.9 Overexposure of Assemblies to UV.....	Page 21
3.10 Setting Up and Maintaining a Light Curing Process.....	Page 21
3.11 Maximizing Lamp Performance.....	Page 22

## 4. SURFACE PREPARATION AND DISPENSING

4.1 Surface Preparation.....	Page 23
4.2 How are DYMAX Light Curing Materials (LCMs) Typically Applied?.....	Page 23
4.3 Packaging Options .....	Page 24
4.4 Common Dispensing Pitfalls.....	Page 24

## 5. TABLES

5.1 Viscosity.....	Page 25
5.2 Hardness .....	Page 26
5.3 Temperature Conversion .....	Page 26
5.4 Units Conversion .....	Page 27
5.5 Estimating Usage.....	Page 27
5.6 DYMAX Trade Names .....	Page 27
5.7 DYMAX Part Numbers and Suffixes.....	Page 28
5.8 Common Plastics.....	Page 29
5.9 Intensity Conversion Table .....	Page 29
5.10 Light Curing Conveyor Exposure Times and Dosage.....	Page 30

## 6. INDEX

# 1. DYMAX CORPORATION

## 1.1 ABOUT DYMAX

DYMAX Corporation was founded in 1980. The first products developed and sold were based on its patented two-part structural acrylic adhesive systems, primarily to the automotive market. Within several years, DYMAX introduced the first practical, structural-strength UV curing adhesive. Today, DYMAX has over \$30 million in annual revenue and over 150 employees globally. Approximately 50% of sales are to countries outside of the United States. DYMAX Corporation is ISO 9001:2000 certified. The corporate headquarters is in Torrington, Connecticut with wholly owned subsidiaries in Germany (Frankfurt), China (Changzhou) and Hong Kong, and venture partners, representatives, and distributors worldwide. This expansion into Europe and Asia has allowed DYMAX to better support and supply the growing number of manufacturers in these regions.



**DYMAX Corporation**  
318 Industrial Lane  
Torrington, CT 06790 USA  
**Phone:** 860-482-1010  
**Fax:** 860-496-0608  
**E-Mail:** [info@dymax.com](mailto:info@dymax.com)  
[www.dymax.com](http://www.dymax.com)

**DYMAX Europe GmbH**  
Trakehner Strasse 3  
D-60487 Frankfurt am Main Germany  
**Phone:** 49.69.7165.3568  
**Fax:** 49.69.7165.3830  
**E-Mail:** [dymaxinfo@dymax.de](mailto:dymaxinfo@dymax.de)  
[www.dymax.de](http://www.dymax.de)

**DYMAX UV Adhesives & Equipment (Shenzhen) Co., Ltd**  
Room 807, Talfook Building  
No. 9 Shihua Road  
Futian Free Trade Zone  
Shenzhen, China 518038  
**Phone:** 86.755.83485759  
**Fax:** 86.755.83485760  
**E-Mail:** [dymaxasia@dymax.com](mailto:dymaxasia@dymax.com)  
[www.dymax.com.cn](http://www.dymax.com.cn)

**DYMAX Asia (HK)**  
Unit 1006, 10/F., Carnarvon Plaza  
No. 20, Carnarvon Road, T.S.T.  
Kowloon, Hong Kong  
**Phone:** 852.2460.7038  
**Fax:** 852.2460.7017  
**E-Mail:** [dymaxasia@dymax.com](mailto:dymaxasia@dymax.com)  
[www.dymax.com.cn](http://www.dymax.com.cn)

# 1. DYMAX CORPORATION

## 1.2 WHAT DOES DYMAX SELL?

Light Curing Materials\* (LCMs) and light curing equipment make up the majority of DYMAX's sales. DYMAX is the only major manufacturer of both light curing materials and light curing equipment. This focus on light curing technology coupled with the synergy produced by designing both the materials and equipment, uniquely positions DYMAX as the Technical Leader in light curing technology. The primary uses of DYMAX products are:

### Light Curing Materials

- ❖ **Adhesives** – primarily for glass, plastic, metal, and ceramic
- ❖ **Coatings** – primarily conformal (for electronics) and thick decorative coatings
- ❖ **Encapsulants** – for electronics, especially on flexible circuits
- ❖ **Shallow Potting Compounds** – primarily less than 3/8" deep
- ❖ **Masking Materials** – primarily for protection during coating, plating, and blasting processes
- ❖ **Gaskets** – primarily for sealing against moisture and reducing noise

### Light Curing Equipment

- ❖ **Spot Lamps** – for small areas
- ❖ **Flood Lamps** – for larger areas
- ❖ **Conveyors** – for large scale production
- ❖ **Radiometers** – for measuring light intensity

In addition to its light curing materials, DYMAX also produces a line of two-part, no-mix structural acrylic adhesives. Contact DYMAX Technical Service to learn more about the

uses, properties, and advantages of these fast-setting, high-strength magnet and metal bonding adhesive systems.

DYMAX has developed over 3,000 light curing products and often creates custom formulations for individual customers. The products are sold primarily through a worldwide network of Distributors and Manufacturer's Representatives.

## 1.3 WHO USES DYMAX?

Manufacturers from many industries use DYMAX products to increase productivity (i.e. lower total assembly costs). The majority of DYMAX customers are manufacturers from the following markets:

- Medical
- Electronics
- Automotive
- Aerospace
- Telecommunications
- Optical
- Packaging
- Industrial

Over 50% of Fortune 500 manufacturers in these markets are direct or indirect DYMAX customers and about half of DYMAX's sales are to countries outside the United States.

*Note: \* Light Curing Materials, or LCMs, is a general term for the technology described in this guide. Past papers and literature authored by DYMAX and other companies have more specifically referred to this technology as Light Curing Adhesives, or LCAs. Recent advances in light curing technology have created new classes of materials, such as thick layer coatings, gaskets, sealants, potting and encapsulating systems and dome coatings. Throughout this guide, LCMs will be used to better describe the broad range of products now available.*

# 1. DYMAX CORPORATION

## 1.4 ADVANTAGES OF DYMAX LIGHT CURING MATERIALS (LCMs)

Each DYMAX customer will perceive and realize a unique set of benefits from DYMAX products, but there are a few features/benefits that DYMAX customers consistently cite:

FEATURE	BENEFIT
<b>Fast Light Cures "On Demand"</b>	❖ Reduces overall assembly costs
	❖ Reduces labor costs
	❖ Easier automation
	❖ Easier alignment of parts before cure
	❖ Improves in-line inspection
	❖ Reduces work-in-progress
	❖ Shorter cycle times
	❖ Shorter lead times to customers
	❖ Fewer assembly stations required
<b>One-Component</b>	❖ Eliminates racking
	❖ Eliminates ovens/heat curing
	❖ Reduces overall assembly costs
	❖ Eliminates mixing
	❖ Eliminates pot life issues, less waste
	❖ Less expensive dispensing equipment
	❖ No hazardous waste due to purging/poor mixing
❖ No static mixers	
❖ Easier to operate/maintain dispensing systems	
<b>Environmentally and Worker Friendly</b>	❖ Better worker acceptance
	❖ No explosion-proof equipment
	❖ Reduces health issues
	❖ Reduces regulatory costs
❖ Reduces disposal costs	
<b>Wide Range of LCMs with Customization Available</b>	❖ Reduces disposal costs
	❖ Wide range of viscosities available
	❖ Wide range of hardnesses available
	❖ Adhesion to a wide range of substrates
	❖ Clear, fluorescing, and colored formulas
	❖ Multiple curing options
❖ Over 3,000 formulations available	

### Limitations of Light Curing Materials (LCMs)

As with all products, there are limitations associated with LCMs. The most obvious limitation of LCMs is that they are only appropriate in applications where, after assembly, the LCM can be exposed to light\*. Where light curing technology is not feasible, consider using two-part, no-mix structural acrylics (ideal for bonding magnets and metal substrates). Contact DYMAX Technical Service for more information on these fast-setting, high-strength magnet and metal bonding adhesive systems.

Generally, LCMs are limited to cure depths of ¼" -½". There are upper and lower limits for each of the physical properties associated with DYMAX products, like hardness, viscosity, temperature resistance, etc. For more information on the properties of DYMAX LCMs, see **Section 2.2 Typical Properties of DYMAX Materials (LCMs)**.

*\*Through the use of patented adhesive and curing processes, DYMAX can now cure through most UV-blocked substrates, provided they transmit visible light.*

## 1.5 SPECIFIC ADVANTAGES OF DYMAX LCMs OVER OTHER CHEMISTRIES

Adhesives, sealants, coatings, gaskets, masks, etc. can vary in many ways. Here are just a few:

- Curing process
- Bond strength to specific substrates
- Viscosity, hardness, flexibility
- Speed of cure, depth of cure
- Minimum or maximum gap required/allowed
- Shrinkage, CTE, Tg
- Moisture, heat, cold, UV, and thermal cycling resistance
- Environmental impact
- Worker safety
- Dispensing and curing equipment/process required
- Pot life, shelf life, and stability
- Color, clarity, odor
- Pricing and packaging
- Blooming, stress cracking

# 1. DYMAX CORPORATION

Each potential adhesive/coating application and customer will have a unique set of requirements, and for each application there are chemistries that fit well and those that don't fit as well. The following section highlights the advantages of DYMAX LCMs versus competing chemistries. Be aware that an advantage shared by both chemistries will not be listed, i.e. "no mixing" is not listed as an advantage in the section comparing DYMAX LCMs to hot melts since neither technology requires mixing.

## 1.5.1 VERSUS ONE-PART SILICONES

3 Indicates Superiority		Feature
DYMAX LCM	Silicone	
3		<b>Faster Cures</b> – 100% cure in 1-30 seconds upon exposure to light versus silicones that require exposure to humidity for 30 minutes to several days to properly cure.
3		<b>Stronger Bonds</b> – Typically 500-4,000 psi versus 100-500 psi for silicones.
3		<b>No Silicone Contamination</b> – Silicones can migrate across an entire plant affecting the wetting and adhesion of surfaces that require coating or bonding.
3		<b>Unaffected by Humidity</b> – Moisture cured silicones often require humidity chambers because humidity greatly affects their cure speed. The DYMAX light curing process is essentially unaffected by humidity.
3		<b>Longer Shelf Life</b> – Moisture cured silicones can be "spoiled" prior to use if exposed to humidity and usually have a 3-6 month shelf life. DYMAX LCMs are unaffected by exposure to ambient humidity and typically have a 1-year shelf life.
	3	<b>Bonds Opaque Substrates</b>
	3	<b>Light Curing Equipment Not Required</b>
	3	<b>Higher Temperature Resistance</b> – Upwards of 200°C for silicones versus a maximum of 150-175°C for most DYMAX LCMs.

## 1.5.2 VERSUS CYANOACRYLATES (CAs)

3 Indicates Superiority		Feature
DYMAX LCM	Cyanoacrylate	
3		<b>Faster Cures</b> – 100% cure in 1-30 seconds versus CAs which merely fixture in 10-60 seconds.
3		<b>Unlimited "Open Time"</b> – DYMAX LCMs do not begin curing until exposed to high intensity light providing an unlimited "open time". CAs have a short "open time" of 10-30 seconds.
3		<b>Better Temperature Resistance</b> – Cyanoacrylates are not recommended for high temperature (225°F or greater) applications. Many DYMAX LCMs can withstand temperatures of –65°F or 300°F long term.
3		<b>Better Moisture Resistance</b> – Cyanoacrylates are not designed for high humidity or long term moisture exposure, whereas DYMAX LCMs can be formulated to exhibit excellent moisture resistance.
3		<b>Better Impact Resistance</b> – Cyanoacrylates are typically very brittle and have little impact resistance versus DYMAX light curing formulations that can range from flexible to rigid.
3		<b>Better Gap Cures</b> – DYMAX LCMs typically cure through gaps of ¼" or more versus cyanoacrylates which require intimate contact.
3		<b>No "Blooming"</b> – Cyanoacrylates can produce a white haze around the bond-line after cure.
3		<b>No Stress Cracking</b> – Cyanoacrylates can impart tiny cracks in plastic prior to cure.
3		<b>Won't Bond Skin on Contact</b>
3		<b>Less Odor</b>
	3	<b>Light Curing Equipment Not Required</b>
	3	<b>Bonds Opaque Substrates</b>
	3	<b>Bonds Rubber</b>

# 1. DYMAX CORPORATION

## 1.5.3 VERSUS TWO-PART EPOXIES

3 Indicates Superiority		Feature
DYMAX LCM	Two-Part Epoxy	
3		<b>Faster Cures</b> – 100% cure in 1-30 seconds versus epoxies that require several hours at room temperature or minutes with high temperature cure.
3		<b>Meter Mix Equipment Not Required</b>
3		<b>Unlimited Pot Life</b>
3		<b>Do Not Require Purge Cycles that Result in Hazardous Waste</b>
3		<b>Better Impact Resistance</b>
3		<b>Both Flexible and Rigid Formulations Available</b>
	3	<b>Can be Better for Applications Requiring Extreme Chemical Resistance</b>
	3	<b>Less Expensive Per Pound</b>
	3	<b>Light Curing Equipment is Not Required</b>
	3	<b>Bonds Opaque Substrates</b>

## 1.5.4 VERSUS ONE-PART EPOXIES

3 Indicates Superiority		Feature
DYMAX LCM	One-Part Epoxy	
3		<b>Faster Cures</b> – 100% cure in 1-30 seconds versus epoxies that require 5-60 minutes with heat curing ovens.
3		<b>Longer Shelf Life</b> – Most one-part epoxies exhibit a shelf life of 6 months or less versus DYMAX LCMs which typically offer a 12 month shelf life. Some one-part epoxies require refrigerated or frozen storage whereas DYMAX recommends room temperature storage for almost all of its LCMs.
3		<b>Heat Curing Not Required</b> – One-part epoxies typically require a heat cure of 220°F or more for 20 minutes or more.
3		<b>Better Impact Resistance</b>
3		<b>Both Flexible and Rigid Formulations Available</b>
	3	<b>Light Curing Equipment Not Required</b>
	3	<b>Bonds Opaque Substrates</b>
	3	<b>Can be Better for Applications Requiring Extreme Chemical Resistance</b>

## 1.5.5 VERSUS TWO-PART URETHANES

3 Indicates Superiority		Feature
DYMAX LCM	Two-Part Urethanes	
3		<b>Faster Cures</b> – 100% cure in 1-30 seconds versus two-part urethanes that require five minutes to several hours, with or without heat curing ovens.
3		<b>Expensive Meter Mix Equipment Not Required</b>
3		<b>Does Not Require Purge Cycles that Result in Hazardous Waste</b>
3		<b>Unaffected by Humidity</b>
3		<b>No Free Isocyanates</b> – Isocyanates can be a worker hazard and can lead to hazardous waste.
	3	<b>Light Curing Equipment Not Required</b>
	3	<b>Bonds Opaque Substrates</b>
	3	<b>Less Expensive Per Pound</b>



# 1. DYMAX CORPORATION

## 1.5.6 VERSUS HOT MELTS

3Indicates Superiority		Feature
DYMAX LCM	Hot Melts	
3		"Cure on Demand" – DYMAX LCMs have an unlimited "open time" unlike hot melts that begin curing immediately upon dispensing.
3		Stronger Bonds
3		Hot Melt Guns and Heated Pots / Lines Not Required
3		Less likely to Damage Heat Sensitive Substrates
3		No Risk of Burning Workers
3		Higher Temperature Resistance
3		Optically Clear Formulations Available
3		Less Prone to Environmental Degradation
3		Wide Range of Viscosities Available
3		Not Stringy – Unlike hot melts which can be stringy during dispensing.
	3	Light Curing Equipment Not Required
	3	Bonds Opaque Substrates
	3	Less Expensive Per Pound

## 1.5.7 VERSUS SOLVENT-BASED ADHESIVES

3Indicates Superiority		Feature
DYMAX LCM	Solvent-Based Adhesives	
3		Faster Cures – in as little as 0.5 seconds.
3		"Cure on Demand" – Ensures properly aligned parts prior to cure, unlike solvent-based materials that begin curing immediately upon assembly.
3		No Stress Cracking – Solvents can impart tiny cracks in plastic surfaces.
3		Bonds Dissimilar Plastics, Thermoset Plastics, Metals, Glass, Rubber, and Ceramics
3		Fills Gaps – DYMAX LCMs are more forgiving of part fit.
3		Less Odor
3		Non-Flammable Liquid
3		Special Ventilation Not Typically Required
3		More Worker Friendly
3		More Environmentally Compliant
	3	Light Curing Equipment Not Required
	3	Bonds Opaque Substrates
	3	Less Expensive per Pound

## 2. DYMAX LIGHT CURING MATERIALS (LCMs)

### 2.1 THE CHEMISTRY BEHIND DYMAX LIGHT CURING MATERIALS (LCMs)

DYMAX LCMs contain ingredients known as photoinitiators. Photoinitiators begin the curing reaction upon exposure to certain wavelengths of light. DYMAX LCMs are usually one-component mixtures of oligomers, monomers, photoinitiators, and modifiers (hardness modifiers, colorants, fluorescing agents, thickeners, wetting agents, etc.). Over 95% of DYMAX LCMs are acrylates (a urethane backbone with an acrylic functional group). The balances are cationic epoxies. Be aware that acrylates and cationic epoxies are, aside from being light curable, significantly different from traditional acrylics and epoxies. The two chemistries also vary in many ways from each other.

#### UV Curing Acrylates Generally Offer:

- *Faster and deeper cures*
- *Wider range of properties*
- *Adhesion to a wider range of substrates*
- *Complimentary cure mechanisms, including visible light and heat*

#### UV Curing Cationic Epoxies Generally Offer:

- *Superior adhesion to certain substrates (i.e. PP, PE, silicone)*
- *Superior resistance to some solvents*
- *Moderate speed and depth of cure (UV curing acrylates cure faster and deeper)*
- *Tack-free surface cures, even at very low intensity (some UV curing acrylates exhibit a tacky surface due to oxygen inhibition)*

### 2.2 TYPICAL PROPERTIES OF DYMAX LIGHT CURING MATERIALS (LCMs)

Since its inception, DYMAX has developed over 3,000 light curing formulations and continues to create new products, typically at the request of customers. The following section describes the “*typical*” properties of these 3,000+ formulations when considered in aggregate. Be aware that DYMAX products exist (or can be created) with properties beyond these “*typical*” properties.

#### 2.2.1 CURE SPEED

DYMAX LCMs typically cure in 1-30 seconds, depending upon the following:

- *Formula* – Cure speed can vary significantly between formulas.
- *Light Source* – Higher intensity light source will typically result in a faster cure.
- *Thickness, Substrates, and Oxygen Exposure* – Significantly thicker films of DYMAX LCMs may require a longer cure time (differences of 0.010" or less generally do not affect cure speed). When curing through a substrate, better light transmission provides faster cures. Surfaces exposed to oxygen during cure may require longer cure times, see [Section 3.5 Eliminating Tacky Surfaces](#).

For more information on light curing, see [Section 3.2 Basic Concepts of Light Curing](#).

#### 2.2.2 DEPTH OF CURE

Light curing materials vary greatly in their “ultimate” depth of cure. DYMAX LCMs typically feature superior depth of cure versus competitive light curing materials. Some materials (especially older technology) can only be light cured to a millimeter or less. Most DYMAX formulations, those that cure with both UV and visible light, typically cure to a depth of ¼" to ½" (0.6 to 1.3 cm). Some formulas are even capable of quickly curing over 1" (2.5 cm) deep. For more information on light curing, see [Section 3.2 Basic Concepts of Light Curing](#).

#### 2.2.3 ADHESION

Each DYMAX LCM offers some adhesion to every substrate, it's just a question of bond strength. In practical terms, DYMAX provides materials capable of structurally bonding glass, metals, plastics, rubbers, and ceramics. When discussing the adhesion of DYMAX materials, it is important to consider the following:

## 2. DYMAX LIGHT CURING MATERIALS (LCMs)

- **Substrate(s)** – The adhesion of a DYMAX material is dependent upon the formulation and the substrate(s). For example, Light-Weld 481 offers terrific bond strength to polycarbonate and moderate adhesion to metal, whereas Light-Weld 605 offers terrific adhesion to glass and metal and moderate adhesion to polycarbonate.
- **Coatings** – When considering adhesion, it is important to consider surface cleanliness and whether or not the surface is treated, painted or plated. For example, DYMAX's best aluminum adhesive might not be the best candidate for bonding a coated aluminum surface. Furthermore, if the coating's adhesion to the underlying substrate is weak, the overall bond strength of the assembly will also be weak since "a chain is only as strong as its weakest link".
- **Stresses** – When choosing a DYMAX product for a given application, it is important to consider the stresses that might be encountered in use, including tensile, shear, peel, cleavage, torque, and impact. More flexible products generally perform better than rigid products in cleavage, peel, and impact.
- **Cohesive Strength** – Normally, "adhesion" refers to the ability of an adhesive to "stick" to a substrate, but in a practical sense, the cohesive strength of the adhesive is also important, i.e., the ability of an adhesive to resist tearing and fracture. Compared to CAs (which can be very brittle) and silicones (which can easily tear), light cured systems are very tough and compare favorably with epoxy and urethane systems.

Due to the complexities associated with adhesion, it is important to consult with DYMAX Selector Guides and DYMAX Technical Service when selecting candidate DYMAX materials. Candidate materials should then be thoroughly tested to determine their suitability for a given application.

### 2.2.4 VISCOSITY

Viscosity is the degree to which a fluid resists flow under an applied force (like gravity, pressure, or mixing). Water, by definition, has a viscosity of 1 centipoise (cP). DYMAX LCMs range in viscosity from 40 cP (similar to olive oil) to over 1,000,000 cP (like peanut butter), and anywhere in between. In many cases, the viscosity of a formula can be modified up or down without altering any of the other properties such as cure speed, adhesion, hardness and moisture resistance. Many DYMAX formulations can be purchased in multiple viscosities, like the 3069 family shown in the table at the bottom of this page.

Notice the part numbers are identical except for the descriptive suffix. The product data sheet for each product family lists the specific viscosity options available for that product family. **Table 5.1 Viscosity** on page 25 shows the viscosity of common fluids for comparison.

It should be noted that viscosity alone does not provide a complete description of the flow characteristics of a fluid. Most DYMAX resins can be classified as either Newtonian or thixotropic. The viscosity of a Newtonian fluid is unaffected by agitation or shear. A thixotropic material (most DYMAX gels, for example) will "thin" (have a lower viscosity) upon shear (dispensing/mixing) and will, upon sitting, return to its original viscosity. DYMAX typically uses a viscometer to measure viscosity. When comparing viscometer measurements of different materials, be sure that the viscosities were measured using the same spindle at the same shear rate (rpm) and temperature.

Product Name	Viscosity Description	Viscosity @ 20 rpm	Measurement Method	Fluid Type
3069	Standard	450 cP (mPa • s) nominal	Rotational Viscometer	Newtonian
3069-T	Thick	5,700 cP (mPa • s) nominal	Rotational Viscometer	Thixotropic
3069-VT	Very Thick	14,000 cP (mPa • s) nominal	Rotational Viscometer	Thixotropic
3069-Gel	Gel	25,000 cP (mPa • s) nominal	Rotational Viscometer	Thixotropic

## 2. DYMAX LIGHT CURING MATERIALS (LCMs)

### 2.2.5 HARDNESS AND FLEXIBILITY

The hardness of a DYMAX material is generally measured on one of three hardness scales, Shore -OO (softest), Shore A (soft), and Shore D (hard). DYMAX LCMs can be formulated to be as soft as JELL-O® (shore OO-0), as hard as Formica® (shore D 90), and anywhere in between. In general, softer materials provide better impact resistance and peel strength, but lower tensile strength and tear resistance. Selection of a given hardness (a rough indication of flexibility) should be based on the anticipated stresses. *Table 5.2 Hardness* on page 26 shows the hardness of common materials for comparison.

### 2.2.6 TEMPERATURE RESISTANCE

DYMAX LCMs provide excellent temperature resistance, both hot and cold. It is important, however to understand the effects of temperature upon performance. Temperature affects the performance of all adhesives, coatings and sealants in two ways:

**Performance at Temperature** – Some cured performance characteristics (such as adhesion, hardness, and more) vary with temperature. In other words, an adhesive may have bond strength of 2,000 psi at 70°F, but only 1,000 psi at 200°F. In general, adhesion and hardness decrease with increasing temperature. Performance testing should be conducted over the temperatures anticipated during use.

**Performance After Temperature Exposure** – Some cured performance characteristics (such as hardness) can be altered permanently after exposure to extreme temperatures. For example, high temperature exposure can result in embrittlement and low temperature exposure can result in cracking. In the case of embrittlement or cracking, the resin will perform differently after extreme temperature exposure. In general, LCMs have an upper thermal limit of 300°F (150°C) with some DYMAX products capable of withstanding higher temperatures. Most DYMAX LCMs have a lower temperature limit of -65°F (-54°C). Many DYMAX products can withstand more extreme temperatures for a short period

of time. For example, many DYMAX products can withstand a solder reflow process that can reach temperatures over 230°C, but only for a few minutes. The recommended temperature limits listed on each product data sheet are determined by evaluating the stress/strain curves of a virgin specimen with one that has been exposed to an extreme temperature for 30 minutes, both at room temperature. When the stress/strain curve demonstrates a significant change, the material is said to have exceeded its thermal limit. The operating temperature limits for each product are located on each product data sheet.

### 2.2.7 THERMAL CYCLING

Thermal cycling testing is frequently used to simulate thermal cycling that might be encountered in use, especially in electronic and automotive applications. Predicting the performance of a DYMAX material in a specific thermal cycling test is very difficult as it depends upon many factors:

- *Adhesion to the substrates*
- *Coefficient of Thermal Expansion (CTE) and modulus of the substrates and the DYMAX material*
- *Part geometry (including mass)*
- *High and low test temperatures*
- *Cycle and transition times*

Thermal cycling and temperature resistance testing on actual customer parts is recommended to confirm the suitability of a specific DYMAX material for a specific application.

### 2.2.8 CHEMICAL AND MOISTURE RESISTANCE

In general, cured DYMAX materials (chemically cross-linked systems) are relatively resistant to both moisture and chemicals. Chemical resistance in a particular application is, however, difficult to quantify since it depends upon the formula, the chemical (and its concentration), the temperature, the time frame, and part geometry. To expand upon part geometry, for example, a DYMAX material which may be suitable for one application with little exposed resin,

## 2. DYMAX LIGHT CURING MATERIALS (LCMs)

may be unsuitable for another application where more resin is exposed. DYMAX recommends that chemical resistance testing relevant to the customer's application be performed during validation.

Moisture resistance in a particular application, like chemical resistance, is also difficult to quantify without specific testing since there are so many variables that affect it. Moisture resistance, however, is such a common inquiry that DYMAX conducts moisture absorption testing on most of its LCMs. About 90% of DYMAX materials absorb less than 10% of their weight in water when soaked in either boiling water for 2 hours or room temperature water for 24 hours. Some DYMAX materials absorb as little as 0.01% of their weight under these conditions. DYMAX water absorption testing is conducted on 2.25" diameter x ¼" thick "pucks" that are 100% exposed to water (versus testing only as an adhesive or coating).

### 2.2.9 CLARITY, COLOR, FLUORESCING, AND REFRACTIVE INDEX

DYMAX materials are available with any of several different appearances.

- **Optically Clear** – *Some grades are so clear that they are even used to laminate sunglass lenses!*
- **Translucent** – *Some grades are translucent with a hazy, yellow or white appearance. Thinner layers of these materials usually appear clear.*
- **Fluorescing** – *Some formulas are colorless, but contain a UV fluorescing agent that, when exposed to a "blacklight", fluoresce brightly.*
- **Colored** – *Several colored materials are available, including blue, red, yellow, white, and even black! It should be noted that colorants may negatively affect cure speed and depth of cure.*

Refractive index is the ratio of the speed of light in a vacuum to that through a transparent material. Soda lime glass, for example, has a refractive index of 1.510. In general, the refractive index of DYMAX materials ranges from 1.419-1.585. Most plastics and glass materials fall into a similar range. Therefore DYMAX adhesives rarely distort light visibly and provide clear, sharp bond lines.

### 2.2.10 SHRINKAGE AND COEFFICIENT OF THERMAL EXPANSION (CTE)

DYMAX materials typically shrink 2-3% linearly during cure. A low shrinkage series of DYMAX adhesives, the OP-LS series, shrink < 0.1% linearly upon cure, a property which has been very well received by the precision Optical market.

The Coefficient of Thermal Expansion (CTE) is the rate at which a material expands with increasing temperature and contracts with decreasing temperature. DYMAX materials typically exhibit a CTE in the range of 40-250 PPM/°C. Some of the low shrinkage products described above exhibit even lower CTEs. The topic of CTE can become quite involved in situations where parts are cycled through large temperature ranges. Specific questions should be directed to a DYMAX technical expert.

### 2.2.11 OUTGASSING

DYMAX LCMs typically outgas slightly during the light curing process (typically <1% as an adhesive and <3% as a coating, by weight). Cured DYMAX LCMs (like most polymers) will also outgas slightly at high temperatures and/or low pressures.

DYMAX has developed a line of lower outgassing, light curing materials. For more specific information on low outgassing products, contact DYMAX Technical Service.

### 2.2.12 ODOR

DYMAX LCMs, like most adhesives and coatings, have a characteristic odor. It is typically slight and easily eliminated with positive fresh air exhaust.

### 2.2.13 FLAMMABILITY

Uncured DYMAX light curing materials have a flashpoint above 200°F and are therefore classified as non-flammable. Cured DYMAX light cure coatings have UL-94 V<sub>0</sub> or V<sub>1</sub> ratings when tested per United Laboratories.

## 2.3 CHEMICAL SAFETY

Please refer to *Lit077 Chemical Safety* for information on the use of DYMAX light curing materials.

## 2. DYMAX LIGHT CURING MATERIALS (LCMs)

### 2.4 ENVIRONMENTAL IMPACT

DYMAX LCMs are generally considered environmentally preferable to other chemical assembly methods.

The typical environmental profile of DYMAX LCMs is:

- *No solvents*
- *No Ozone Depleting Compounds (ODCs)*
- *Compliant with European RoHS regulations*
- *Meet Montreal Protocol and Clean Air Act*
- *Cured material is typically not considered hazardous waste*
- *All products comply with TSCA regulations*

### 2.5 SPECIFICATIONS

Many DYMAX LCMs have been approved or classified by third party organizations like Mil Spec, UL, ISO, USP, IPC, GM, Ford, Telcordia, etc. Contact DYMAX Technical Service for the specific products that have been classified or approved by these organizations.

Testing all of our products to all of the specifications invoked across all markets is cost prohibitive. The testing that has been accomplished to date has typically been driven by customer requests or market demands. Often, our untested products can also meet the above specifications (as well as other specifications not mentioned). Where third party specifications or testing is required for a single customer application, testing costs are usually shared.

### 2.6 SHELF LIFE AND STORAGE

DYMAX offers a 12-month shelf life from the date of shipment from DYMAX, when properly stored in the original, unopened container. A handful of DYMAX products have a shorter shelf life (3 or 6 months). For most DYMAX products, storage temperatures between 40°-90°F (4°-32°C) are recommended (although a handful requires refrigeration). Specific shelf life and storage information is available on each product data sheet.

For a charge, DYMAX may be able to extend the shelf life (up to 3 months) of expired LCMs that pass re-certification testing.

### 2.7 CLEANING AND REWORK

Workers should avoid skin contact through the use of impervious (like nitrile rubber) gloves and other protective equipment as described in *Lit077 Chemical Safety*. In the event that there is skin contact, users should immediately wash with soap and water. Isopropyl alcohol (IPA) is typically recommended for flushing dispensing fluid lines (if needed) and removing uncured adhesive from assembly equipment. Do not use acetone, MEK, or other ketones as they may leave an incompatible residue.

Rework, or removing cured material, is typically a challenge due to the bond strength and chemical resistance of DYMAX materials. Some solvents (like methyl alcohol, methylene chloride, etc.) or heat can soften cured materials making them easier to remove. Contact DYMAX Technical Service for more guidance on reworking and removing cured DYMAX materials.


### 2.8 DISPOSAL

DYMAX materials are used in many different cities, states, and countries, each with varying environmental regulations. It is therefore difficult to provide strict guidance regarding disposal. In the United States, cured DYMAX materials are generally considered plastic industrial waste and can be disposed of similarly. Small quantities of unused light curing material may be cured prior to disposing using either sunlight or a light curing lamp. DYMAX recommends that customers comply with state, local, and federal regulations when disposing of DYMAX LCMs.

## 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS

### 3.1 UV AND VISIBLE LIGHT

The electromagnetic spectrum is divided into different regions based on wavelength. UV light is the range of shorter wavelengths adjacent to the visible light spectrum. Visible light is the only portion of the electromagnetic spectrum that the eye can see. Wavelengths in these regions are commonly measured in nanometers (nm). A nanometer is a billionth of a meter or a thousandth of a micron. DYMAX formulations typically require UVA light (320-400 nm) and/or the shorter wave (blue) visible light (400-450 nm) for curing. The UVA range is generally considered the safest of the three UV ranges (UVA, UVB, and UVC). UV cured inks often require the UVB portion of the UV spectrum for curing. A chart depicting the electromagnetic spectrum is shown below.

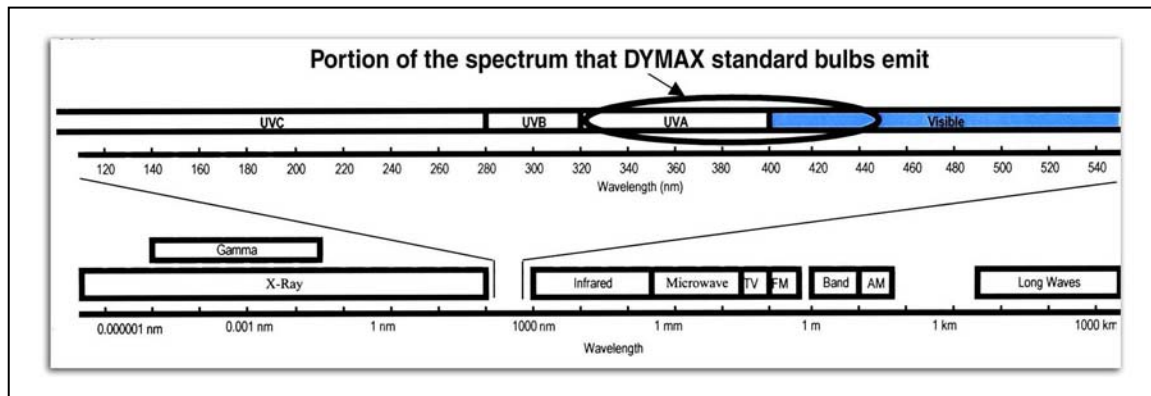

### 3.2 BASIC CONCEPTS OF LIGHT CURING

Developing a successful light curing process requires knowledge of several key concepts. This section will provide an overview of these concepts.

- **How it Works** – Curing with light is a relatively simple process. DYMAX LCMs contain ingredients known as photoinitiators that initiate the curing reaction upon exposure to certain wavelengths of light. Except for cationic epoxies, all DYMAX LCMs reach full cured properties immediately after exposure to light of appropriate wavelength, intensity, and duration. Cationic epoxies reach full cured properties within 24 hours after light exposure. Product data sheets for cationic epoxies will state that full properties require an additional 24 hours.
- **Higher Intensity = Faster Cures** – Intensity is the light energy reaching a surface per time and it is often measured in  $mW/cm^2$ . When using the term intensity, it is important to define which wavelength(s). Higher intensity light (of the proper wavelengths) will generally provide a faster cure.
- **Distance and Substrates Affect Intensity** – Distance from a light curing lamp, always affects intensity. Intensity decreases with increasing distance from both spot lamps and flood lamps, especially spot lamps. Intensity decreases with increasing distance from the focal point for focused beam systems. When curing through a substrate, light transmission rates below 100% will reduce the intensity that reaches the LCM. See Section 3.7 Light Curing through Transparent, UV-Blocked Substrates.
- **Limited Depth of Cure** – LCMs themselves absorb light and so each DYMAX material has a maximum cure depth. For most products, this depth is between  $\frac{1}{4}$ " and  $\frac{1}{2}$ ". Also, it may take 3-4 times longer to cure a product  $\frac{1}{2}$ " deep than it did to cure that same product  $\frac{1}{4}$ " deep.

## 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS

- **Determining Complete Cure** – *The simple answer is that a DYMAX LCM is cured when it changes from a liquid to a solid. A more complete answer is that a DYMAX LCM is fully cured when acceptable physical properties are achieved and further light exposure no longer improves product properties. See Section 3.8 Confirming Complete Cure for more information on this subject.*
- **Shadows** – *Only material that has been exposed to light of appropriate wavelength, intensity, and duration will reach full cure properties. Material in “shadowed areas” will not cure unless the material has a secondary curing option. For more information on curing in shadowed areas, see Section 3.6 Shadow Curing.*


### 3.3 LIGHT CURING EQUIPMENT

DYMAX provides light curing spot lamps, flood lamps, conveyors, and radiometers. This section contains a brief description of each type of equipment. Contact your DYMAX representative or visit [www.dymax.com](http://www.dymax.com) for more information on DYMAX light curing equipment.

#### 3.3.1 POWER SUPPLY OPTIONS

The power supply is an important consideration when selecting a light curing lamp. DYMAX manufactures spot, flood, and focused beam lamps with either a transformer-based or auto-switching power supply. When ordering a transformer-based system, the source voltage must be specified (reference the current **DYMAX Equipment Price List** for voltage options). If the source voltage is different from the factory specified voltage, the lamp may not operate properly (low voltage may produce lower intensity or not ignite at all and high voltage may result in higher intensity

and shorter bulb life). Transformer-based power supplies are typically heavier and cost less than auto-switching power supplies. Auto-switching power supplies are not voltage sensitive and will operate properly on 90V-136V and 180V-264V, at both 50 Hz and 60 Hz. DYMAX offers spot, flood, and focused beam lamps with auto-switching power supplies.

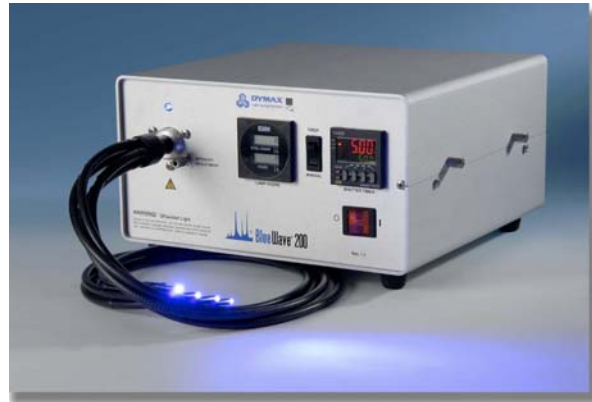

#### 3.3.2 SPOT LAMPS (for small areas up to ½" diameter)

DYMAX spot lamps, like the BlueWave® 200 (above), provide very high intensity (1,000-20,000 mW/cm<sup>2</sup>) over a small area (typically <1/2" diameter). These intensities typically result in a 1 to 10 second cure. DYMAX spot lamps utilize an integral timed/manual shutter mechanism and usually require little external shielding. It should be noted that, because light exiting the light guide is diverging, intensity at the part is very sensitive to the distance between the light guide and the part.

Spot lamps are ideal for curing small areas quickly and can be easily integrated into an automated assembly process or used as turnkey bench top systems.



## 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS

### 3.3.3 FOCUSED BEAM LAMPS

*(high intensity lamps for conveyors)*

DYMAX provides focused beam lamps, like the Fusion® F300S (below), which provide 300-2,500 mW/cm<sup>2</sup> over a 1" x 6" area. Due to their high intensity and smaller curing area, focused beam lamps are typically incorporated into either conveyors or automated assembly equipment (with proper shielding). Line speeds of 3-30 feet are typical. The *Fusion F300S* (available from DYMAX) offers more curing power (intensity x area) than any other lamp available from DYMAX. In addition, the *Fusion F300S* offers the longest bulb life (6,000 hours) and a built in intensity monitor indicates when the bulb has failed.



Fusion® F300S

Focused beam lamps are ideal for conveyors and automated assembly systems.

### 3.3.4 FLOOD LAMPS *(for curing larger areas or many small areas simultaneously)*

DYMAX flood lamps offer moderate intensity (50-225 mW/cm<sup>2</sup>) over a large area (5" x 5" or 8" x 8"). These lamps, like the 5000-EC, are ideal for curing areas larger than ½" in diameter. DYMAX flood lamps can also be used to cure many small parts simultaneously. For example, a spot lamp might cure one small part in 3-5 seconds whereas



DYMAX 5000-EC Light Shield and ZIP™ Shutter

a flood lamp might cure many small parts at one time but slower (say in 10-20 seconds). Light emitted from flood lamps diverges, but much less dramatically than light emitted from a spot system. Therefore, flood lamps vary in intensity with distance, but to a much lesser degree than spot lamps. Unlike a spot lamp, flood lamps do not necessarily utilize an integral shutter so care must be taken to insure a consistent cure time (optional shutter assemblies are available for flood lamps).

Flood lamps, like spot systems, are often incorporated into turnkey bench top and automated assembly systems.

### 3.3.5 CONVEYORS *(for continuous automation)*

DYMAX light curing conveyors incorporate either flood or focused-beam lamps. The advantages of light curing conveyors include consistent cure times and the ability to cure larger parts. Another advantage of this type of system is that it emits essentially no stray UV light and eliminates the possibility of external exposure. DYMAX conveyors have 12" wide belts, are 6' in length, and allow parts up to 4" tall (risers to increase clearance to 6" or 10" are available). Conveyor speed is tightly controlled and typically ranges between 1-29 feet per minute.

## 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS



DYMAX light curing conveyors are extremely versatile in that they can incorporate several lamp configurations. *Table 5.10 Conveyor Exposure Time and Dosage* on page 30 can help in estimating and comparing the line speeds for common conveyor configurations. For wider customized UV conveyors, contact DYMAX Technical Service.

### 3.3.6 RADIOMETERS (for process control)

A radiometer is a device that measures the intensity and/or energy associated with light of specified wavelengths. UV



light is, by definition, not visible and so a radiometer is the only way to determine UV intensity.

DYMAX offers the ACCU-CAL™ 50 radiometer which measures UVA (320-395 nm) light for spot lamps, floods, and conveyors. The ability to measure light intensity is useful for three reasons:

- *Maintaining a Light Curing Process* – A radiometer can measure whether a light curing system is providing intensity above the minimum or “bulb change” intensity. A radiometer is to a light curing process what a thermometer is to an oven curing process. For more information on this subject, see *Section 3.10 Setting Up and Maintaining a Light Curing Process* on page 21.
- *Insuring a Worker-Friendly Light Curing Process* – A radiometer can be used to determine if any UV light is reaching operators or bystanders.
- *Measuring Transmission Rates Through Substrates* – A radiometer can be used to measure the transmission rates of various wavelengths through substrates that absorb UV and/or visible light. This can be very useful in setting up and maintaining a consistent light curing process.

DYMAX’s ACCU-CAL™ 50 is capable of measuring light intensity from spot lamps, flood lamps, focused-beam lamps, and conveyors.

### 3.3.7 SELECTING A CURING SYSTEM

There are several things to consider when determining whether to utilize a spot lamp, flood lamp, or conveyor. The table on page 19 lists some of the equipment currently available from DYMAX and some key features of each. DYMAX provides CE marked equipment for Europe.

### 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS

	BlueWave® 50 AS	BlueWave® 200	2000-EC	5000-EC	12" Conveyor with 5000-ECs	12" Conveyor with Fusion® F-300S
Type of lamp	Spot	Spot	Flood	Flood	Conveyor	Conveyor
Maximum Curing Area	½" (13 mm) Diameter	½" (13 mm) Diameter	8" x 8" (20 cm x 20 cm)	5" x 5" (13 cm x 13 cm)	12" (30 cm) Wide	12" (30 cm) Wide
Maximum Intensity (mW/cm <sup>2</sup> )	3,000	20,000	75	225	225	4,000
Typical Cure Speeds	5-20 seconds	1-10 seconds	10-30 seconds	5-15 seconds	1-10 fpm <sup>α</sup> (0.3-3 mpm <sup>β</sup> )	3-30 fpm <sup>α</sup> (0.3-9.1 mpm <sup>β</sup> )
Timer / Shutter	Yes (Digital)	Yes (Digital)	Optional	Optional	Digital Speed Control	Digital Speed Control
Typical Bulb Life (Hours)	4,000	2,000	2,000	2,000	2,000	5,000
Typical Bulb Degradation* (Typical % loss at end of bulb life)	<50%	<50%	<15%	<15%	<15%	<2%
Footprint	11.5" x 12" (29 cm x 30 cm)	11.5" x 11.5" (29 cm x 29 cm)	16" x 11.5" (41 cm x 29 cm)	16" x 11.5" (41 cm x 29 cm)	3' x 6' (0.9 m x 1.8 m)	3' x 6' (0.9 m x 1.8 m)
Voltage	100-260V <sup>c</sup>	100-260V <sup>c</sup>	90-260V <sup>c</sup>	90-260V <sup>c</sup>	5000-ECs: 90-260V Conveyor: 115V or 230V	Fusion F300S: 230V Conveyor: 230V

\*Bulb degradation is significantly dependent upon lamp use. See Section 3.11 Maximizing Lamp Performance for more information on bulb degradation and proper lamp operation.

<sup>α</sup> fpm (feet per minute)

<sup>β</sup> mpm (meters per minute)

<sup>c</sup> Auto switching power supply. Lower cost, transformer based versions are available.

#### 3.3.8 EQUIPMENT TRIAL RENTAL / LEASE PROGRAM

Customers in the United States and Canada can use a DYMAX Equipment Trial Rental/Lease Program to evaluate lamps at a very low cost. The highlights of the program are:

- Two week free rental
- Up to eight additional weeks rental at a rate of 3% of the cost per week
- Rental fees are deducted from the cost at purchase
- Customer pays shipping
- Customer completes Rental Agreement
- DYMAX requires a purchase order for the equipment in case it is not returned or is damaged

Contact DYMAX Customer Service to initiate the DYMAX Trial Rental/Lease Program. Equipment rental programs are also be available in other locations.

#### 3.4 UV LAMP SAFETY

Please refer to *Lit133 UV Lamp Safety* for information on the safe operation of DYMAX light curing equipment.

#### 3.5 ELIMINATING TACKY SURFACES

In some cases, air exposed surfaces of DYMAX adhesives may remain tacky after cure. This is caused by oxygen inhibition. Oxygen in the air actually slows the cure at the top-most layer of air exposed surfaces. This tackiness does not necessarily indicate incomplete cure as this tackiness is observed with some materials, even after complete cure. In general, there are four options available to help minimize or eliminate the tackiness associated with oxygen inhibition:

## 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS

- **Longer and/or Higher Intensity Cure** – In most cases, curing longer or with higher intensity will minimize or eliminate a tacky surface. In general, higher intensity cures overcome oxygen inhibition more efficiently. For example, Multi-Cure® 984-LVUF conformal coating requires approximately 30 seconds of exposure to 200 mW/cm<sup>2</sup> (or 6 Joules/cm<sup>2</sup> of energy) to cure “tack-free”. This same coating cures “tack-free” in approximately 1 second upon exposure to 4,000 mW/cm<sup>2</sup> (or 4.0 Joules/cm<sup>2</sup> of energy).
- **Use of a “Shortwave” Bulb** – Use of a UVB (shortwave) bulb instead of a UVA (longwave) bulb may also help to eliminate surface tack. Both longwave and shortwave bulbs are available from DYMAX. UVA (longwave) bulbs come standard in DYMAX lamps because they typically provide faster, deeper curing of DYMAX materials.
- **Choose an Alternate DYMAX Material** – Each formula is affected by oxygen inhibition to a different degree. Some formulas cure “tack-free instantly” while others remain tacky even after long, high intensity cures. Contact DYMAX Technical Service to determine if a tack-free alternative is available.
- **Blanket with Inert Gas** – Although rarely used, blanketing with inert gas (like nitrogen or argon) during cure can often eliminate the problem of oxygen inhibition completely. Argon is heavier than oxygen (versus nitrogen which is lighter) and is ideally suited for blanketing.

Contact DYMAX Technical Service for further information on oxygen inhibition.

### 3.6 SHADOW CURING

There are many adhesive applications where, due to geometry of the assembly, some portion of the LCM is “shadowed” from the curing light. In these areas, the material will not cure unless it has been formulated to cure by some additional curing mechanism.

DYMAX has developed three types of secondary cure mechanisms: heat, oxygen, and catalyzed two-part mix. Heat

is the most commonly used secondary cure mechanism. The typical heat cure schedule is as follows:

- 1 hour at 225°F (107°C)
- 30 minutes at 250°F (121°C)
- 15 minutes at 300°F (149°C)

It should be noted that heat curing alone will rarely cure oxygen-exposed surfaces to a tack-free condition. Initial exposure to light is required before heat curing to obtain a tack-free surface cure. Contact DYMAX Technical Service for more information on the other secondary cure mechanisms.

### 3.7 LIGHT CURING THROUGH TRANSPARENT, UV-BLOCKED SUBSTRATES


In 1995, DYMAX introduced the first adhesives that not only cure with UV light, but also with visible light (400-450 nm). This resulted in faster, deeper cures and the ability to cure through visibly translucent, but UV-blocking substrates. Products capable of curing with both UV and visible light typically bear the DYMAX trade name Ultra Light-Weld® or Ultra Fast™.

### 3.8 CONFIRMING COMPLETE CURE

“How do I know when a DYMAX material is fully cured?” is a frequently asked question. The simplest answer is that the DYMAX material is cured when the material changes from a liquid to a solid. Oftentimes, this explanation is satisfactory.

A more complete answer, however, is that a DYMAX LCM is fully cured when further curing does not improve its physical properties. Quantitative testing of specimens cured for various cure times can be used to determine complete cure. The graph on the next page shows how this method could be used in a bonding application.

### 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS

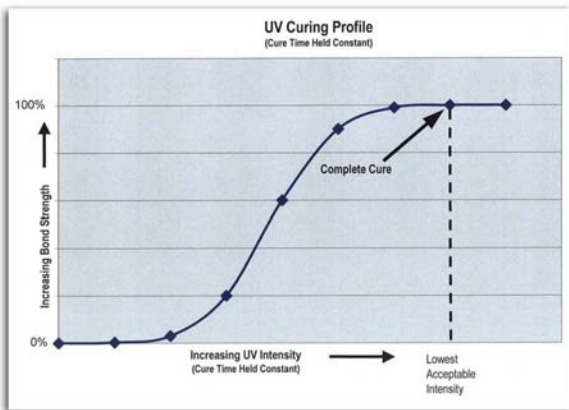

Each DYMAX material's product data sheet provides light curing guidelines for a limited number of lamps and configurations. Actual cure times will almost certainly differ for each specific application. DYMAX always recommends confirming the suitability of a given light curing process through "lifetime testing" of parts manufactured using this process.

#### 3.9 OVEREXPOSURE OF ASSEMBLIES TO UV

The effect of underexposure is obvious; incomplete cure. The effects of overexposure are more complex. Generally, double and triple exposures (two to three times the dosage required to cure) have no measurable adverse affect on DYMAX products. However, significant overexposure to UV light can degrade any UV cured material and some substrates (especially plastics). This degradation may appear as cracking, physical distortion, changes in color, chalking, and/or a change in some physical property such as an increase in hardness or decrease in elongation. The degree of degradation will depend upon several factors including intensity of the lamp, the wavelengths transmitted to the adhesive, temperature in curing area, exposure time, substrates, and formulation. This degradation is caused by both the UV light itself and excessive heat absorption. A cooling fan in the curing area can help minimize the effect of excessive heat absorption.

Significant overexposure of the LCM to UV is unlikely to occur in a properly controlled curing process. End-users should test and validate their assembled devices at the lower and upper operating limits of their light curing process.

#### 3.10 SETTING UP AND MONITORING A LIGHT CURING PROCESS

There are two parameters that must be considered to insure a successful light curing process, 1) intensity at the curing location and 2) cure time. DYMAX recommends setting up and monitoring a UV light curing process as follows:

1. **Choose a Light Curing Material (LCM)** – Select an LCM that satisfies the performance of the application.
2. **Determine Available Cure Time** – Determine the cure time available so that the UV curing process is not a "bottleneck" in the manufacturing process. For example, if dispensing and assembly requires 12 seconds per part in a one piece flow process, the maximum available cure time is 12 seconds. For UV curing conveyor, determine the minimum line speed required.
3. **Choose a Light Curing System** – Choose the appropriate light curing system that will fully cure the LCM within the cure time available. DYMAX Technical Service can help you identify the best light curing system for a specific application.
4. **Determine the Lowest Acceptable Intensity** – The lowest acceptable intensity is that which fully cures the resin in the available cure time (determined above). The lowest acceptable intensity can be determined through quantitative testing of parts cured at various intensities as shown in the diagram to the top left. In the case of a focused-beam lamp on a conveyor, determine the lowest acceptable energy, not intensity.

*The techniques on the following page may be used to artificially modify intensity to facilitate determining the lowest acceptable intensity.*

## 3. DYMAX LIGHT CURING EQUIPMENT / PROCESS

- **Increase Distance** – Since light emitting from light curing lamps diverges, the intensity decreases as the distance from the lamp increases.
  - **Utilize an Old Bulb** – When increasing intensity is not practical, older bulbs can be used. As with any manufacturing process, it is advisable to operate with a safety factor. DYMAX recommends a “bulb change” intensity above the “lowest acceptable intensity”.
5. **Monitor and Maintain Intensity** – Using a radiometer, monitor the UV light intensity at the bond line. If the intensity reaches the “bulb change” intensity, install a new bulb or conduct appropriate maintenance (see **Section 3.11 Maximizing Lamp Performance** below). In the case of a conveyor, curing energy (not intensity) should be monitored.

If the resulting cure process is causing heat damage, a cooling fan or shorter cure time is recommended. If the resulting bulb life is too short, a longer cure time or higher intensity lamp is recommended.

### 3.11 MAXIMIZING LAMP PERFORMANCE

There are three ways to maximize lamp performance:

- **Proper Set-Up** – The first key to maximizing lamp performance is proper set-up. Reference the operation manual provided with each DYMAX lamp for instructions on proper set-up. After ignition, wait 3-5 minutes before use to allow the lamp to reach full intensity. Then, use the following techniques to maximize intensity at the curing location.
  1. **Spot Cure Systems** – Maximize curing intensity by minimizing distance from the end of the lightguide to the light curing material, while still covering the curing area. Positive airflow can prevent those vapors commonly emitted during cure from condensing on the end of a lightguide. Be aware that excessive bending, clamping or set screw tightening can damage lightguides. The minimum bend radii for standard lightguide diameters are as follows:
    - 3 mm lightguides – 40 mm bend radius
    - 5 mm lightguides – 60 mm bend radius
    - 8 mm lightguides – 100 mm bend radius
  2. **Flood Lamps** – Minimize distance from the bottom of the flood housing to the light curing material. Note that distances 3” or more from the lamp housing provide the most uniform intensity across the curing area.
  3. **Focused Beam Lamps** – Place light curing material at the focal point of the focused beam lamp for maximum intensity. The focal distance for the Fusion® F300S is 2.1” below the lamp housing.
    - **Optimizing Bulb Life** – The intensity of light being emitted from UV bulbs gradually decreases with usage (except in the Fusion F300S). This degradation cannot be avoided, but it can be minimized through proper operation.
      - The longest bulb life is obtained by simply using the lamp continuously (not turning it off). The more often the lamp is cycled on and off, the more quickly the bulbs degrade. The general rule of thumb is to leave the lamp on if it will be used again within four hours.
      - Once ignited do not turn the lamp off for at least five minutes. Turning the lamp off before it has reached its operating temperature can damage the bulb.
    - **Proper Maintenance** – As with all production equipment, routine maintenance will optimize performance. In the case of a spot lamp, keep the end of the lightguide clean and replace if it no longer transmits enough light (a lightguide simulator is available from DYMAX to help determine lightguide transmission). See **Lit069 Lightguide Simulator** for more information on lightguide and bulb maintenance. In the case of a flood lamp, the reflector and lamp base (sockets that the bulb fit into) should be cleaned and/or replaced as necessary. Please refer to the Operation Manual for each lamp for further guidance on proper maintenance.

## 4. SURFACE PREPARATION AND DISPENSING

### 4.1 SURFACE PREPARATION

Appropriate surface preparation can help maximize the wetting and adhesion of a DYMAX LCM to a given substrate. In most cases, no surface preparation provides adequate results. Where improved performance is required, DYMAX recommends testing the effectiveness of these surface preparation options.

#### 4.1.1 CLEANING

Cleaner surfaces produce stronger, longer lasting bonds. If sufficiently strong bonds are provided without cleaning, cleaning may not be required.

Both the contaminant and the substrate(s) should be considered when developing a cleaning process. Particulates can be removed with high-pressure air or brushing while chemical contaminants require aqueous (water) or solvent-based cleaners. The aqueous or solvent-based cleaner should be selected such that it removes the contaminant without harming the substrate.

#### 4.1.2 ABRASION

In general, abrasion creates more surface area for bonding which typically improves bond strength. Abrasion can also be used to remove a coating or surface layer.

#### 4.1.3 CORONA OR PLASMA TREATMENT

These surface treatment operations can be useful for improving bond strength to hard-to-bond to plastic substrates. Both treatments can be incorporated into a batch or automated assembly process.

#### 4.1.4 PLASTIC MOLDING

The plastic molding process can dramatically affect adhesion to the molded part. An adhesive may have terrific adhesion to a part from one molder and no adhesion to the same part produced by another molder. In these cases, excess internal or external mold release may be present on the surface of

the molded part. Internal mold release can be removed from the surface, but it may migrate back to the surface over the life of the part. Lifetime tests that involve heated storage or thermal cycling may help determine whether this migration will occur. External mold release may be removed through cleaning, abrasion, or seeking an alternate plastic source (either finished or raw).

In the case of molding filled plastic parts, molding pressures and temperatures may affect the concentration of filler present on the surface. In many cases, a DYMAX adhesive adheres significantly better to either the resin or the filler. In these cases, variations in the surface concentration of the filler can cause significant variations (up to 5X in magnitude) in the overall adhesion. Please contact DYMAX Technical Service for more guidance on improving wetting and bond strength through surface preparation.

### 4.2 HOW ARE DYMAX LIGHT CURING MATERIALS (LCMs) TYPICALLY APPLIED?

Since DYMAX LCMs are typically one component and available in a wide range of viscosities, many different dispensing methods can be used including needle dispensing, spraying, brushing, stenciling, screen-printing and coating.

The most common dispensing method involves a dispensing needle, which is either applied to a dispensing valve or a syringe. The pictures below represent the two most common needle dispensing systems.

Roll coating, stenciling, and screen printing are effective methods of applying a thin layer of adhesive or coating to large, flat areas quickly. Contact your DYMAX representative for more information on recommended dispensing methods.

## 4. SURFACE PREPARATION AND DISPENSING

### 4.3 PACKAGING OPTIONS

DYMAX materials are typically available in many different package sizes. The following is a list of some package sizes available in the North America:

- *Syringes* (3 mL, 10 mL, and 30 mL)
- *Cartridges* (170 mL, 300 mL, and 600 mL)
- *Bottles* (10 mL, 30 mL, 250 mL, and 1 liter)
- *Pails* (15 liters)
- *Drums* (~200 kilograms, depending upon density of formula)



Additional packaging options may be available where grams are substituted for mL and kilograms are substituted for liters. Be aware that medium to gel viscosity materials can trap air during shipping when packaged in bottles, pails, and drums due to the open headspace. Syringes and cartridges have no headspace and remain essentially air-free. Lower viscosity materials (<500 cP) release air bubbles naturally and are bubble-free in all packages. Some higher viscosity products (whose viscosity is measured using ASTM D-1084) will also release air. Products whose viscosity is measured by ASTM D-2556 will not release air naturally.

It should be noted that not all products are available in all package sizes. Contact your DYMAX representative for more guidance on packaging.

### 4.4 COMMON DISPENSING PITFALLS

There are several mistakes that customers can make when implementing dispensing systems for DYMAX materials. Understanding these common pitfalls and taking the suggested precautions will allow trouble-free dispensing:

- **Incompatible Materials** – Dispensing system materials of construction should be compatible with DYMAX LCMs. Metal parts and fittings should only be 300 Series stainless steel. Other metals can cause the adhesive to polymerize. Plastic materials that are compatible with DYMAX LCMs include polyethylene, polypropylene, Teflon, Nylon and acetals. Other plastics may be attacked by the resin.
- **Transparent Fluid Lines** – Black or opaque plastic fluid lines should be used to ensure that the adhesive is not exposed to ambient light, which may cause the adhesive to polymerize.
- **Air Bubbles** – Air bubbles may become trapped in fluid lines when an empty adhesive container is removed for replacement in a dispensing system. To avoid this possibility it is recommended that the fluid line be purged after refilling or replacing the empty container. Maintaining only the line length necessary to transport the fluid from the reservoir to dispense point will facilitate the purging process.
- **Pour-In Pressure Pot versus Drop-in Pressure Pot** – For lower viscosity fluids (<500 cP) that naturally release air bubbles, (see **Section 4.3 Packaging Options** top left) either pour-in or drop-in pressure pots can be used. For fluids that do not release air bubbles naturally, drop-in pressure pots are recommended. (Drop-in pressure pots are large containers into which bottles or pails of adhesive are placed). DYMAX recommends the use of a 10 gallon drop-in pressure pot for adhesives with viscosities up to 25,000 cP. For resins with viscosity >25,000, or where pressure exceeding 30 psi is required for dispensing, “ram-style pail pumps” are recommended.
- **Excessive Air Pressure** – The application of excessive air pressure (>30 psi) to pressure pots may cause air to dissolve into the adhesive. When this pressure is alleviated (either when the pressure pot is opened or the fluid is dispensed) this dissolved air may come out of the solution in the form of air



## 4. SURFACE PREPARATION AND DISPENSING

bubbles that become trapped in the adhesive. To maintain appropriate pressure and prevent the formation of air bubbles in the adhesive, use larger ID fittings and tubing, minimize tubing length, fully open the dispense valve, use a shorter and larger ID dispensing needle. If none of this is effective and pressure of 30 psi or greater is still needed, a "ram-style pail pump" is recommended. This involves force being applied directly to the adhesive in the pail via a follower plate allowing for very high pressures without air. "Ram-style pail pumps" are recommended for resins with a viscosity of 25,000 cP or greater.

- **Narrow and Long Fluid Lines** – Generally, the shorter and wider the fluid line, the better. A fluid line diameter of 3/8" is desirable. The longer and narrower the line, the more air pressure is required to transfer the fluid to the dispense valve. This can result in a slow flow rate, and the need for high pressure to move the material with the unfortunate result of air bubble formation as mentioned above under "Excessive Air Pressure".
- **High Shear Pumps and Valves** – The use of pumps that produce shear, such as gear pumps, is not recommended with DYMAX LCMs. Shear occurs when the adhesive is caught between two tightly fitting, moving metal parts, which

can cause the adhesive to polymerize and clog the system. Simple pressure pots with pneumatic and "ram-style pail pump" systems are recommended.

- **Positive Displacement Valves** – Positive displacement valves should be tested for compatibility with DYMAX LCMs prior to their incorporation into a dispense system. Contact DYMAX for further guidance in selecting an appropriate valve for dispensing a particular adhesive.
- **Using Vacuum to Remove Air Bubbles** – A vacuum should not be used to remove air bubbles from DYMAX LCMs. This may remove constituents from the adhesive, altering performance and/or reducing its shelf life.
- **Excessive Vacuum Suck-Back on Syringe Dispensers** – Caution should be taken to apply only the amount of suck-back or vacuum pressure needed to prevent adhesive drip following dispensing. Excessive vacuum pressure may pull the plunger out of the syringe barrel or suck air into the syringe, creating bubbles.
- **Incorrect Cartridge Fitting** – One quarter inch (1/4") NPT fittings are not recommended for use with DYMAX LCMs supplied in SEMCO cartridges. Although the fitting in the nozzle appears to be a standard 1/4" NPT, it is tapered and requires a modified fitting.

## 5. TABLES

### 5.1 VISCOSITY

Approximate Viscosity in Centipoise (cP) and Milli-Pascals-Seconds (mPa•s) at Room Temperature	Fluid
1	Water
80	Olive Oil
200	Motor Oil (SAE 30)
3,000	Honey
8,000	Molasses
65,000	Vaseline
100,000	Sour Cream
150,000-250,000	Peanut Butter

## 5. TABLES

### 5.2 HARDNESS

Durometer Hardness Scales*			
OO	A	D	Feels Like:
		90	Formica®
		80	Polycarbonate
	-	70	
-	-	58	
-	-	46	
-	90	39	
-	85	33	
-	80	29	
-	75	25	Auto Tire Treads
-	70	22	
-	65	19	Pencil Eraser
-	60	16	
-	55	14	
90	50	12	Pink Eraser
88	45	10	
86	40	-	
83	35	-	
80	30	-	Rubber Band
76	25	-	Gummy Bear candy
70	20	-	
62	15	-	
55	10	-	
45		-	

\*This chart is for comparison purposes only. This is NOT a conversion chart.

### 5.3 TEMPERATURE CONVERSION

To Fahrenheit F° = (9/5 x C°) + 32 To Centigrade C° = (5/9) x (F° - 32)							
°F	°C	°F	°C	°F	°C	°F	°C
-65	-54	40	4	145	63	250	121
-60	-51	45	7	150	66	255	124
-55	-48	50	10	155	68	260	127
-50	-46	55	13	160	71	265	129
-45	-43	60	16	165	74	270	132
-40	-40	65	18	170	77	275	135
-35	-37	70	21	175	79	280	138
-30	-34	75	24	180	82	285	141
-25	-32	80	27	185	85	290	143
-20	-29	85	29	190	88	295	146
-15	-26	90	32	195	91	300	149
-10	-23	95	35	200	93	305	152
-5	-21	100	38	205	96	310	154
0	-18	105	41	210	99	315	157
5	-15	110	43	215	102	320	160
10	-12	115	46	220	104	325	163
15	-9	120	49	225	107	330	166
20	-7	125	52	230	110	335	168
25	-4	130	54	235	113	340	171
30	-1	135	57	240	116	345	174
35	2	140	60	245	118	350	177

### 5.4 UNITS CONVERSION\*

Length	1 meter = 100 centimeter = 1,000 millimeter = 10 <sup>6</sup> microns = 1.094 yards = 3.281 feet = 39.37 inches
Area	1 m <sup>2</sup> = 10,000 cm <sup>2</sup> = 10.76 ft <sup>2</sup> = 1550 in <sup>2</sup>
Volume	1 liter = 1,000 mL = 1,000 cm <sup>3</sup> = 0.001 m <sup>3</sup> = 0.2642 gal = 1.0567 qt = 2.113 pt = 33.81 fluid oz = 0.3531 ft <sup>3</sup> = 61.02 in <sup>3</sup> 1 gallon = 3.785 liters
Weight	1 kilogram = 1,000 grams = 1,000,000 milligrams = 35.27 ounces = 2.205 pounds
Speed	1 meters/min = 0.01667 meters/sec = 3.281 feet/min = 0.05467 feet/sec = 38.62 inches/min = 0.6560 inches/sec
Heat Transfer and Thermal Conductivity	1 Watt = 3.412 BTU/hr 1 W/m <sup>2</sup> °K = 0.5778 BTU/(Hr•Ft <sup>2</sup> •°F)
Force	1 lb. force = 4.448 Newtons
Pressure	1,000 PSI = 6.895 MPa = 70.307 kg/cm <sup>2</sup>

\*For a more complete list of unit conversions, visit [www.onlineconversion.com](http://www.onlineconversion.com)

## 5. TABLES

### 5.5 ESTIMATING USAGE

Thickness of the Bond Line Gap or Coating	Theoretical Area Covered by 1 Liter of Adhesive or Coating
0.002" (51 μm)	30,500 in <sup>2</sup> (212 ft <sup>2</sup> ) (19.7 m <sup>2</sup> )
0.005" (127 μm)	12,200 in <sup>2</sup> (84.7 ft <sup>2</sup> ) (7.88 m <sup>2</sup> )
0.010" (254 μm)	6,100 in <sup>2</sup> (42.4 ft <sup>2</sup> ) (3.94 m <sup>2</sup> )
0.015" (381 μm)	4,070 in <sup>2</sup> (28.3 ft <sup>2</sup> ) (2.63 m <sup>2</sup> )

Bead Size	Theoretical Usage (Length per Liter)
1/32" (.79 mm)	66,300 ft (20,200 m)
1/16" (1.6 mm)	16,600 ft (5,100 m)
3/32" (2.4 mm)	7,400 ft (2,300 m)
1/8" (3.2 mm)	4,100 ft (1,200 m)
3/16" (4.8 mm)	1,900 ft (580 m)
1/4" (6.4 mm)	1,000 ft (300 m)

Common Calculations		
Circumference	Circle	= diameter x $\pi^*$
Area	Rectangle	= length x width
	Circle	= radius <sup>2</sup> x $\pi^*$
	Cylindrical Surface	= diameter x length x $\pi^*$
Volume	Rectangular Solid	= length x width x height
	Sphere	= 4/3 x radius <sup>3</sup> x $\pi^*$
	Cylinder	= radius <sup>2</sup> x $\pi^*$ x length

\*  $\pi$  is approximately 3.14159

### 5.6 DYMAX TRADENAMES

Trade Name	Description
BlueWave®	Curing Equipment
Crosslink®	Epoxies
Cure-Point™	Silicone Potting Compound
LIGHT-CAP®	LED/LCD Encapsulant
Light Weld®	UV Cure Materials
Light-Welder®	Curing Equipment
MD®	Medical Device Adhesives
Multi-Cure®	Light Cure Adhesives with Secondary Cure
<b>SPEEDMASK®</b>	Light Curable Masking Resins
Ultra Light-Weld®	UV and Visible Cure Materials
Ultra-Red™	Red Fluorescing

## 5. TABLES

### 5.7 DYMAX PART NUMBERS AND SUFFIXES

Part Number	Description
1xx-M	Medical Grade Materials
11xx-M	
1-2xxxx	
2xx	
2xxxx	Activator-Cured Materials and LCMs (variety of applications)
3xx	Fiber Optic LCMs (old system)
3xxx	Plastic Bonding LCMs
3-xxxx	
3-2xxxx	
4xx	Glass Bonding LCMs
4-xxx	
4-2xxxx	
5xx	Activators, Primers, Accelerators
5-2xxxx	Activators
6xx	Metal/Glass/Plastic Bonding LCMs
6-xxx	
6-2xxxx	
7xx	SpeedMask and Medical LCMs
7xxx	
8xx	Activator Cured Magnet/Metal Bonding Adhesives
8-2xxxx	
9xx	Electronic Materials
9xxx	
9-xxx	
9-xxxx	
9-2xxxx	
CAxxx	Cyanoacrylates
GA-xxx	Light Cured Gaskets
MB-2xxx	Activator Cured Magnet Bonding Adhesives
OP-xx	Optical LCMs
OP-4-2xxxx	

Suffix	Description
-B	Black/Blue
-F	Fluorescing
-Gel	Gel
-LV	Low Viscosity
-LVF	Low Viscosity Fluorescing
-LVUF	Low Viscosity, Ultra-Fluorescing
-PF	Pink Fluorescing
-RF	Red Fluorescing
-Rev. A	Revision A
-Rev. B	Revision B
-SC	See-Cure Technology
-SP01	Special Product 01
-SV01	Special Viscosity 01
-T	Thick
-UF	Ultra Fluorescing
-ULF	Ultra Light-Weld <sup>®</sup> Fluorescing
-UR	Ultra-Red <sup>™</sup> Fluorescing
-v.	Version
-VLV	Very Low Viscosity
-VT	Very Thick
-VTS	Very Thick Special

## 5. TABLES

### 5.8 COMMON PLASTICS

Abbreviation	Chemical Name	Common Trade Names
ABS	Acrylonitrile-butadiene-styrene	Lustran <sup>®</sup> , Terluran <sup>®</sup> , Cyclocac <sup>®</sup>
EVA	Ethylene vinyl acetate	
FR-4	Fiber reinforced epoxy	
LDPE	Low-density polyethylene	
LCP	Liquid crystal polymer	
HDPE	High-density polyethylene	
PA	Polyamide	Nylon <sup>®</sup>
PBT	Polybutylene terephthalate	Valox <sup>®</sup>
PC	Polycarbonate	Makrolon <sup>®</sup> , Lexan <sup>®</sup> , Apec <sup>®</sup> , Calibre <sup>®</sup>
PE	Polyethylene	
PEI	Polyetherimide	Ultem <sup>®</sup>
PEEK <sup>®</sup>	Polyetheretherketone	
PES	Polyether sulfone	Ultrason <sup>®</sup> , Udel <sup>®</sup>
PET	Polyethylene terephthalate	
PETG <sup>®</sup>	Glycol-modified PET	Eastar <sup>®</sup>
PI	Polyimide	Kapton <sup>®</sup>
PMMA	Polymethyl methacrylate	Acrylic, Plexiglass <sup>®</sup> , Perspex <sup>®</sup> , Cyrolite <sup>®</sup>
PP	Polypropylene	
PPO	Polyphenylene oxide	Noryl <sup>®</sup>
PPS	Polyphenylene sulfide	Ryton <sup>®</sup>
PS	Polystyrene	Novacor <sup>®</sup> , Styron <sup>®</sup>
PSO	Polysulfone	Ultrason <sup>®</sup>
PUR	Polyurethane rubber	
PVC	Polyvinyl chloride	
PTFE	Polytetrafluoroethylene	Teflon <sup>®</sup>
SAN	Styrene-acrylonitrile	Lustran <sup>®</sup>

<sup>®</sup> Registered trademarks of the following companies: **Atohaas**: Plexiglass **BASF**: Ultrason **Bayer**: Apec, Lustran, Makrolon, Terluran **Cyrolite**: Cyrolite **Dow**: Calibre **DuPont**: Kapton, Mylar, Nylon, Teflon **Eastman**: Eastar **GE**: Lexan, Noryl, Cyclocac, Ultem, Valox **ICI**: Perspex **Nova Chemicals**: Novacor, Zylar **Phillips**: Ryton

### 5.9 INTENSITY CONVERSION TABLE

$\text{Energy(mJ/cm}^2\text{)} = \text{Intensity(mW/cm}^2\text{)} \times \text{Time(seconds)}$
$\text{Intensity(mW/cm}^2\text{)} = \text{Energy(mJ/cm}^2\text{)} / \text{Time(seconds)}$
$1000 \text{ mJ/cm}^2 = 1 \text{ Joule/cm}^2$
$1000 \text{ mW/cm}^2 = 1 \text{ Watt/cm}^2$

## 5. TABLES

### 5.10 CONVEYOR EXPOSURE TIME AND DOSAGE (Typical)

DYMAX Conveyor Lamp Configuration								
Line Speed Feet per Minute	One Fusion F-300S		Two 5000-ECs (in series)		One 5000-EC		One 2000-EC	
	Max – 2,500 mW/cm <sup>2</sup>		Max – 225 mW/cm <sup>2</sup>		Max – 225 mW/cm <sup>2</sup>		Max - 75 mW/cm <sup>2</sup>	
	Exposure Time (Sec)	Energy per cm <sup>2</sup> (Joules)	Exposure Time (Sec)	Energy per cm <sup>2</sup> (Joules)	Exposure Time (Sec)	Energy per cm <sup>2</sup> (Joules)	Exposure Time (Sec)	Energy per cm <sup>2</sup> (Joules)
1	5.0	20.0	50.0	11.0	25.0	5.6	40.0	3.0
2	2.5	10.0	25.0	5.6	12.5	2.8	20.0	1.5
3	1.7	6.7	16.7	3.8	8.3	1.9	13.3	1.0
4	1.3	5.0	12.5	2.8	6.3	1.4	10.0	0.8
5	1.0	4.0	10.0	2.3	5.0	1.1	8.0	0.6
6	0.8	3.3	8.3	1.9	4.2	1.0	6.7	0.5
7	0.7	2.9	7.1	1.6	3.6	0.8	5.7	0.4
8	0.6	2.5	6.3	1.4	3.1	0.7	5.0	0.4
9	0.6	2.2	5.6	1.3	2.8	0.6	4.4	0.3
10	0.5	2.0	5.0	1.1	2.5	0.6	4.0	0.3
11	0.5	1.8	4.6	1.0	2.3	0.5	3.6	0.3
12	0.4	1.7	4.2	1.0	2.1	0.5	3.3	0.3
13	0.4	1.5	3.9	0.9	1.9	0.4	3.1	0.2
14	0.4	1.4	3.6	0.8	1.8	0.4	2.9	0.2
15	0.3	1.3	3.3	0.7	1.7	0.4	2.7	0.2
16	0.3	1.3	3.1	0.7	1.6	0.4	2.5	0.2
17	0.3	1.2	2.9	0.6	1.5	0.3	2.4	0.2
18	0.3	1.1	2.8	0.6	1.4	0.3	2.2	0.2
19	0.3	1.1	2.6	0.6	1.3	0.3	2.1	0.2
20	0.3	1.0	2.5	0.6	1.3	0.3	2.0	0.2
21	0.2	1.0	2.4	0.5	1.2	0.3	1.9	0.1
22	0.2	0.9	2.3	0.5	1.1	0.3	1.8	0.1
23	0.2	0.9	2.2	0.5	1.1	0.3	1.7	0.1
24	0.2	0.8	2.1	0.5	1.0	0.2	1.7	0.1
25	0.2	0.8	2.0	0.5	1.0	0.2	1.6	0.1
26	0.2	0.8	1.9	0.4	1.0	0.2	1.5	0.1

## 6. INDEX

Term	Pages(s)
Acrylated Urethane	10
Abrasion	23
Adhesion	10
Air Bubbles	24, 25
Blooming	7
Bottles	24
Bubbles	24, 25
Bulb	15, 20, 22
Cationic Epoxy	10
Cartridges	24
Chemical Resistance	12-13
Chemical Safety	13
Clarity	13
Clean Air Act	14
Clarity	13
Cleaning	14, 23
Coefficient of Thermal Expansion	13
Color	13
Compatibility with Wetted Substrates	24, 25
Conveyor	17-18, 30
Corona Treatment	23
CTE	13
Curing	10, 15, 16, 20, 21, 22
Cyanoacrylate	7
Degradation	22
Depth of Cure	10, 15
Dispensing	24, 25
Disposal	14
Drums	24
Electromagnetic Spectrum	15
Environmental Profile	14
Epoxy	8, 10
Eye Protection	19
Flammability	13
Flood	17
Fluorescing	13
Gloves	13
Hand Protection	13
Hardness	12, 26
Heat Resistance	12
Hot Melts	9
Incompatible Materials	24, 25
Intensity	15, 29
Isocyanates	8

Term	Page(s)
Lamp Safety	19
Light Curing	10, 15, 16, 20, 21, 22
Moisture Resistance	12
Montreal Protocol	14
Odor	13
Outgassing	13
Overexposure	21
Oxygen Inhibition	19-20
Ozone	19
Packaging	24
Pails	24
Plasma Treatment	23
Radiometer	18
Refractive Index	13
Rental Program	19
Re-Work	14
RoHS	14
Safety	13, 19
Shadows	16, 20
Shelf Life	14
Shielding	17
Shrinkage	13
Shutter	17
Silicone	7
Solvents	9
Specifications	14
Spot Lamps	16
Storage	14
Stress Cracking	7, 9
Surface Preparation	23
Syringes	24
Tackiness	19-20
Temperature Resistance	12
Urethane	8
UV Curing	10, 15, 16, 20, 21, 22
UV Light	15
UV Safety	19
Vacuum	25
Validation	20, 21, 22
Ventilation	13
Visible Light	15
Viscosity	11, 25
Wavelength	15
Worker Safety	13, 19

For further assistance with adhesive and equipment selection, contact DYMAX Applications Engineering.



In the U.S. Call: 877.396.2988  
In North and South America Call: 860.482.1010  
In Europe Call: 0049.69.7165.3568  
In Asia Call: 852.2460.7038

[www.dymax.com](http://www.dymax.com)  
[www.dymax.de](http://www.dymax.de)  
[www.dymax.com.cn](http://www.dymax.com.cn)

DYMAX Corporation - 318 Industrial Lane - Torrington, CT 06790 - Phone: 860.482.1010 - Fax: 860.496.0608 - E-mail: [info@dymax.com](mailto:info@dymax.com) - [www.dymax.com](http://www.dymax.com)

DYMAX Europe GmbH - Trakehner Strasse 3 - D-60487 Frankfurt am Main - Germany - Phone: 0049.69.7165.3568 - Fax: 0049.69.7165.3830 - E-mail: [dymaxinfo@dymax.de](mailto:dymaxinfo@dymax.de) - [www.dymax.de](http://www.dymax.de)

DYMAX UV Adhesives & Equipment (Shenzhen) Ltd - Unit 807, Talfook Building, No. 9 Shi Hua Road, Futian Free Trade Zone, Shenzhen, China 518038 - Phone: 86.755.83485759 - Fax: 86.755.83485760 - E-mail: [dymaxasia@dymax.com](mailto:dymaxasia@dymax.com) - [www.dymax.com.cn](http://www.dymax.com.cn)

DYMAX Asia (HK) - Unit 1006, 10/F., Carnarvon Plaza, No. 20, Carnarvon Road, T.S.T., Kowloon, Hong Kong - Phone: 852.2460.7038 - Fax: 852.2460.7017 - E-mail: [dymaxasia@dymax.com](mailto:dymaxasia@dymax.com) - [www.dymax.com.cn](http://www.dymax.com.cn)

---

© 2005, 2007, 2008, 2009 DYMAX Corporation. All rights reserved. All trademarks in this guide, except where noted, are the property of, or used under license by DYMAX Corporation, U.S.A.

The data contained in this bulletin is of a general nature and is based on laboratory test conditions. DYMAX does not warrant the data contained in this bulletin. Any warranty applicable to the product, its application and use is strictly limited to that contained in DYMAX's standard Conditions of Sale. DYMAX does not assume responsibility for test or performance results obtained by users. It is the user's responsibility to determine the suitability for the product application and purposes and the suitability for use in the user's intended manufacturing apparatus and methods. The user should adopt such precautions and use guidelines as may be reasonably advisable or necessary for the protection of property and persons. Nothing in this bulletin shall act as a representation that the product use or application will not infringe a patent owned by someone other than DYMAX or act as a grant of license under any DYMAX Corporation Patent. DYMAX recommends that each user adequately test its proposed use and application before actual repetitive use, using the data contained in this bulletin as a general guide.

LIT008 Rev. 9/04/2009