

Advanced Materials**Araldite® 420 A/B****Structural Aerospace Adhesives****TWO COMPONENT EPOXY ADHESIVE****Key properties**

- Very high shear and peel strength
- Extremely tough and resilient
- Good moisture resistance
- Bonds a wide variety of materials including metal, wood, rubber, glass fiber reinforced composites and many plastics

Description

Araldite® 420 A/B is a two-component, room temperature curing paste adhesive of high strength and toughness. It is suitable for a wide variety of metal, honeycomb and fibre reinforced composite bonding applications. It has very high shear strength even at temperature up to 70 °C and good peel strength.

Typical uses include:

- Bonding inserts, ferrules, aluminium and composite edge members, joining strips, etc, in both metallic and non-metallic honeycomb sandwich structures.
- Fabrication of composite components using the cut and fold technique.

Product data

Property	Araldite® 420 A	Araldite® 420 B	Mixed adhesive
Colour (visual)	Yellow	Blue	Dark green
Specific gravity	Ca. 1.2	Ca. 1.0	1.1 – 1.2
Viscosity at 25 °C (A93)* (Pa.s)	(100 – 300)*	(0.6 – 1.4)*	35 – 45
Get time at 25 °C (A8)*	-	-	120 – 200 min

** Specified data are on a regular basis analysed. Data which is described in this document as 'typical' is not analysed on a regular basis and is given for information purposes only. Data values are not guaranteed or warranted unless if specifically mentioned.*

Processing**Pretreatment**

The strength and durability of a bonded joint are dependant on proper treatment of the surfaces to be bonded.

At the very least, joint surfaces should be cleaned with a good degreasing agent such as acetone or other proprietary degreasing agents in order to remove all traces of oil, grease and dirt. Alcohol, gasoline (petrol) or paint thinners should never be used.

The strongest and most durable joints are obtained by either mechanically abrading or chemical etching ("pickling") the degreased surfaces. Abrading should be followed by a second degreasing treatment.

Mix ratio	Parts by weight	Parts by volume
Araldite® 420 A	100	100
Araldite® 420 B	40	50

Stir the two components thoroughly together until the two colours are completely blended, without any visible streaks. Automatic mixing / dispensing may be used. Araldite® 420 A/B is also supplied in cartridges incorporating mixers and can be applied as ready to use adhesive with the aid of the tool recommended by Huntsman Advanced Materials.

Usable life

Due to exothermic reaction between the two components the usable life depends to some extent on the usable mixed and the shape of the container. Use of a shallow container will extend the usable life and as a rough guide:

For a 50gm mix, usable life at 25 °C is 2 hours

For a 100gm mix, usable life at 25 °C is 1 hour

Application of adhesive

The resin/hardener mix is applied directly or with a spatula to the pretreated and dry joint surfaces.

A layer of adhesive 0.05 to 0.10mm thick will normally impart the greatest lap shear strength to the joint.

The joint components should be assembled and clamped as soon as the adhesive has been applied. An even contact pressure throughout the joint area will ensure optimum cure.

Curing

Once applied, Araldite® 420 A/B will gel in 2 – 4 hours at 25 °C and will be sufficiently cured after 5 hours to allow the bonded component to be handled. After 4 – 5 days the adhesive will obtain 90% of its full strength and achieve full strength after 1 to 2 weeks at room temperature.

Cure can be accelerated by heating. 4 hours at 50 °C or 1 hour at 120 °C will be sufficient to achieve full strength.

Shear properties can be improved, particularly at elevated temperatures, by post-curing for up to 24 hours at 70 °C.

Lap shear strength after various cure times at 23 °C (typical average values)

5 hours: 1 N/mm²

6 hours: 8 N/mm²

7 hours: 9 N/mm²

Typical cured Properties

These figures are for guidance and do not constitute a specification (typical average values).

Bell peel 150 N / 25mm (60 °C peel using 2024-T3 clad aluminium adherents at 25 °C).


Honeycomb bonding results (in accordance with MIL-A-25463)

Beam shear at 22 °C: 12kN (core failure)

Flatwise tensile at 22 °C: 8.5 N/mm²

Metal: 2024-T3; Core: 7.9 – ¼ - 40 5052

Variation of lap shear strength as a function of temperature (typical average values)

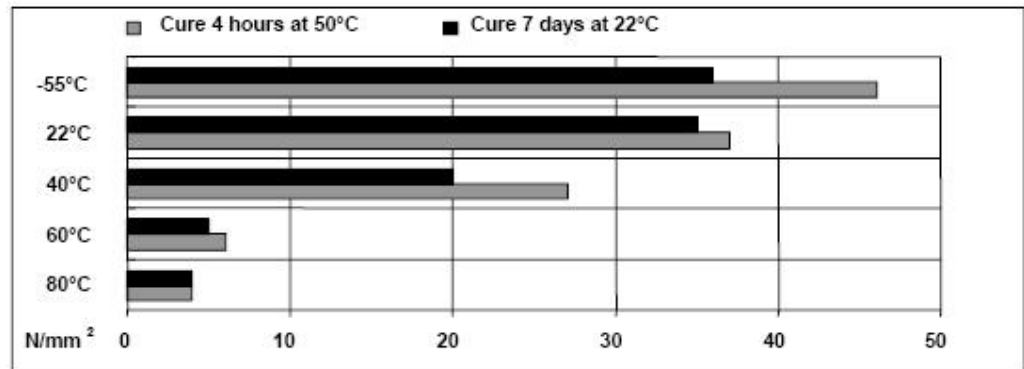


Lap shear strength: variation after exposure to 95% RH at 60°C (typical average values)

(cured 7 days at 23°C)

C = 30 days exposure

A = 90 days + drying for 16 hours at 60°


B = 90 days exposure

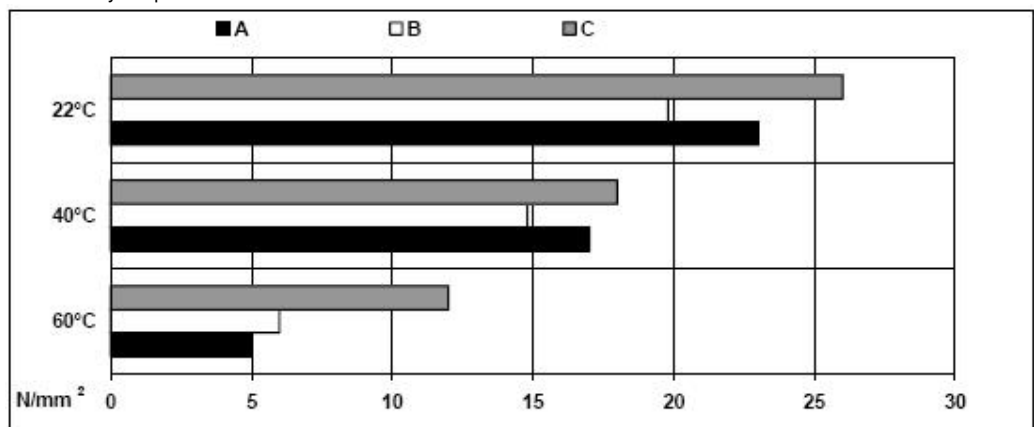

Honeycomb peel performance (typical average values)

(cured 7 days at 23°C)

Tested in accordance with MIL-A-25463 using approx. 300g/m² of Araldite® 420 per skin.

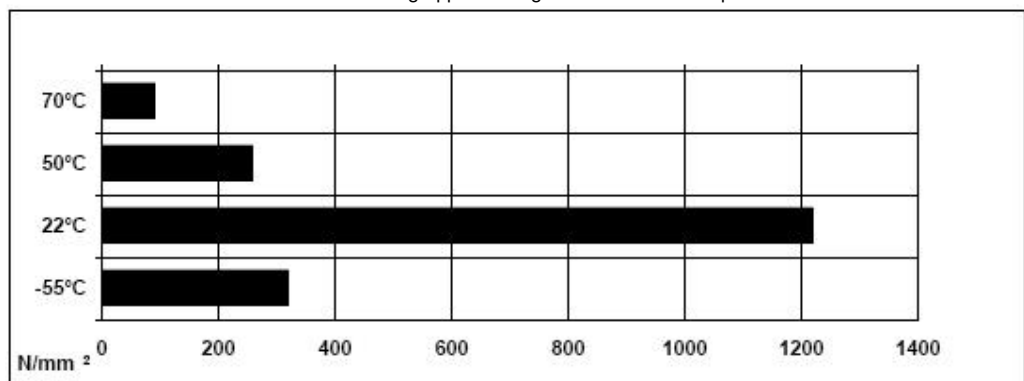

Effect of alternative cure schedules on lap shear strength performance (LSS) (typical average values)

Test		Results		Test methods
Cure cycle		Test temp (°C)	LSS (MPa)	
70 °C for	1 hour	22	37	A.E.C.M.A. EN2243-1
		70	4	
	2 hours	70	6	
	6 hours	70	11	
	16 hours	70	10	
	24 hours	70	8	
120 °C for	1 hour	22	43	A.E.C.M.A. EN2243-1
		50	29	
		70	10	

Storage

Araldite® 420 A/B must be stored for up to 30 months at 18 – 40°C and the components must be stored in their original sealed containers. The expiry date is indicated on the label.

Handling precautions**Caution**

Our products are generally quite harmless to handle provided that certain precautions normally taken when handling chemicals are observed. The uncured materials must not, for instance, be allowed to come into contact with foodstuffs or food utensils, and measures should be taken to prevent the uncured materials from coming in contact with the skin, since people with particularly sensitive skin may be affected. The wearing of impervious rubber or plastic gloves will normally be necessary; likewise the use of eye protection. The skin should be thoroughly cleansed at the end of each working period by washing with soap and warm water. The use of solvents is to be avoided. Disposable paper - not cloth towels - should be used to dry the skin. Adequate ventilation of the working area is recommended. These precautions are described in greater detail in the Material Safety Data sheets for the individual products and should be referred to for fuller information.

Huntsman Advanced Materials
(Switzerland) GmbH
Klybeckstrasse 200
4057 Basel
Switzerland

Tel: +41 (0)61 299 11 11
Fax: +41 (0)61 299 11 12

www.huntsman.com/advanced_materials
Email: advanced_materials@huntsman.com



Huntsman Advanced Materials warrants only that its products meet the specifications agreed with the user. Specified data are analysed on a regular basis. Data which is described in this document as 'typical' or 'guideline' is not analysed on a regular basis and is given for information purposes only. Data values are not guaranteed or warranted unless if specifically mentioned. The manufacture of materials is the subject of granted patents and patent applications; freedom to operate patented processes is not implied by this publication.

While all the information and recommendations in this publication are, to the best of Huntsman Advanced Material's knowledge, information and belief, accurate at the date of publication, **nothing herein is to be construed as a warranty, whether express or implied, including but without limitation, as to merchantability or fitness for a particular purpose. In all cases, it is the responsibility of the user to determine the applicability of such information and recommendations and the suitability of any product for its own particular purpose.**

The behaviour of the products referred to in this publication in manufacturing processes and their suitability in any given end-use environment are dependent upon various conditions such as chemical compatibility, temperature, and other variables, which are not known to Huntsman Advanced Materials. It is the responsibility of the user to evaluate the manufacturing circumstances and the final product under actual end-use requirements and to adequately advise and warn purchasers and users thereof.

Products may be toxic and require special precautions in handling. The user should obtain Safety Data Sheets from Huntsman Advanced Materials containing detailed information on toxicity, together with proper shipping, handling and storage procedures, and should comply with all applicable safety and environmental standards.

Hazards, toxicity and behaviour of the products may differ when used with other materials and are dependent on manufacturing circumstances or other processes. Such hazards, toxicity and behaviour should be determined by the user and made known to handlers, processors and end users.

Except where explicitly agreed otherwise, the sale of products referred to in this publication is subject to the general terms and conditions of sale of Huntsman Advanced Materials LLC or of its affiliated companies including without limitation, Huntsman Advanced Materials (Europe) BVBA, Huntsman Advanced Materials Americas Inc., Huntsman Advanced Materials (UAE) FZE, Huntsman Advanced Materials (Guangdong) Company Limited, and Huntsman Advanced Materials (Hong Kong) Ltd. Huntsman Advanced Materials is an international business unit of Huntsman Corporation. Huntsman Advanced Materials trades through Huntsman affiliated companies in different countries including but not limited to Huntsman Advanced Materials LLC in the USA and Huntsman Advanced Materials (Europe) BVBA in Europe.

All trademarks mentioned are either property of or licensed to Huntsman Corporation or an affiliate thereof in one or more, but not all, countries.

Copyright © 2012 Huntsman Corporation or an affiliate thereof. All rights reserved